

Enginetech Inc
Tech Assistance 800-410-3664 ext. 340 or 237

TECHNICAL BULLETIN	
	June 1999 TB 1703
Mfg:	GM
Model:	C-SERIES
Liter:	6.0L
V I N:	U
Year:	99-06

Revised Oil Gallery Plug Location On
1997-99 GM 4.8, 5.3, 5.7 & 6.0L Engines

The AERA Technical Committee offers the following information regarding a revised oil gallery plug location on 1997-99 GM 4.8, 5.3, 5.7 & 6.0L engines. This information applies only to the new GEN III engines that were introduced in 1997. An engine block rear oil gallery plug location was misstated in original service manual publications. If this plug is installed as indicated in those publications, engine oil flow may be restricted as a portion of the plug may extend into main oil galley.

Original service manual information indicated the plug should be recessed below the rear block face .031-.055" (.08-1.4mm). The correct location should show the plug protruding beyond the rear block face .031-.055" (.08-1.4mm) as shown below in Figure 1. The front portion of this plug incorporates a small O-ring, which may be re-used if it is not damaged.

The AERA Technical Committee

Portions of materials contained herein have been reprinted with permission of General Motors Corporation, Service Operations. This information is provided from the best available sources. However, AERA does not assume responsibility for data accuracy or consequences of its application. Members and others are not authorized to reproduce or distribute this material in any form, or issue it to their branches, divisions, or subsidiaries, etc. at a different location, without written permission.
© Copyright AERA 2006



Reference:	
-------------------	--

TECHNICAL BULLETIN




June 1999

TB 1703

Mfg: GM
Model: C-SERIES
Liter: 6.0L
VIN: U
Year: 99-06

Bulletin Diagram: Untitled Graphic #2408 for TB 01703

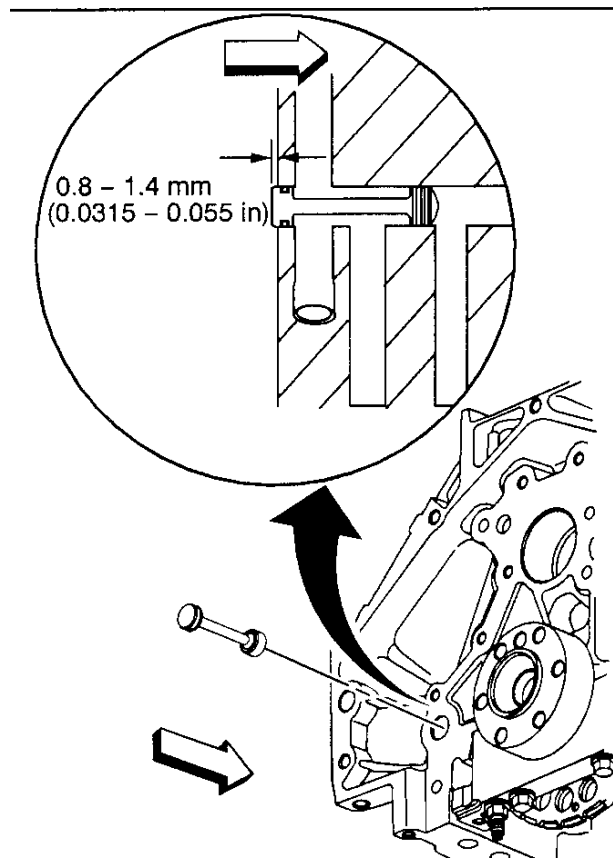

Portions of materials contained herein have been reprinted with permission of General Motors Corporation, Service Operations. This information is provided from the best available sources. However, AERA does not assume responsibility for data accuracy or consequences of its application. Members and others are not authorized to reproduce or distribute this material in any form, or issue it to their branches, divisions, or subsidiaries, etc. at a different location, without written permission.

© Copyright AERA 2006



Reference: