

**Enginetech Inc**  
**Tech Assistance 800-410-3664 ext. 340 or 237**

| TECHNICAL BULLETIN                                                                |                                    |
|-----------------------------------------------------------------------------------|------------------------------------|
|  | <b>June 2003</b><br><b>TB 2077</b> |
| Mfg:                                                                              | GM                                 |
| Model:                                                                            | ACHIEVA                            |
| Liter:                                                                            | 2.4L                               |
| V I N:                                                                            | T                                  |
| Year:                                                                             | 96-02                              |

Rough Engine Idle Or Misfire On  
1999-2000 GM 2.4L VIN T Engines

The AERA Technical Committee offers the following information regarding a rough engine idle or misfire on 1999-2000 GM 2.4L VIN T engines. Some customers may comment on this condition and the check engine light may become illuminated.

Causing this type of condition is a possible spark plug boot spring missing as shown in Figure 1. Check for the presence of the spark plug boot spring by removing each boot and checking for the spring presence at the boot to coil tower connection. If the spring is missing, replace the spark plug boot assembly under Part #12132224.

The AERA Technical Committee

Portions of materials contained herein have been reprinted with permission of General Motors Corporation, Service Operations. This information is provided from the best available sources. However, AERA does not assume responsibility for data accuracy or consequences of its application. Members and others are not authorized to reproduce or distribute this material in any form, or issue it to their branches, divisions, or subsidiaries, etc. at a different location, without written permission.  
© Copyright AERA 2006



|                   |  |
|-------------------|--|
| <b>Reference:</b> |  |
|-------------------|--|

## TECHNICAL BULLETIN




June 2003

TB 2077

Mfg: GM  
Model: ACHIEVA  
Liter: 2.4L  
VIN: T  
Year: 96-02

### Bulletin Diagram: SPARK PLUG BOOT SPRING - OTHER

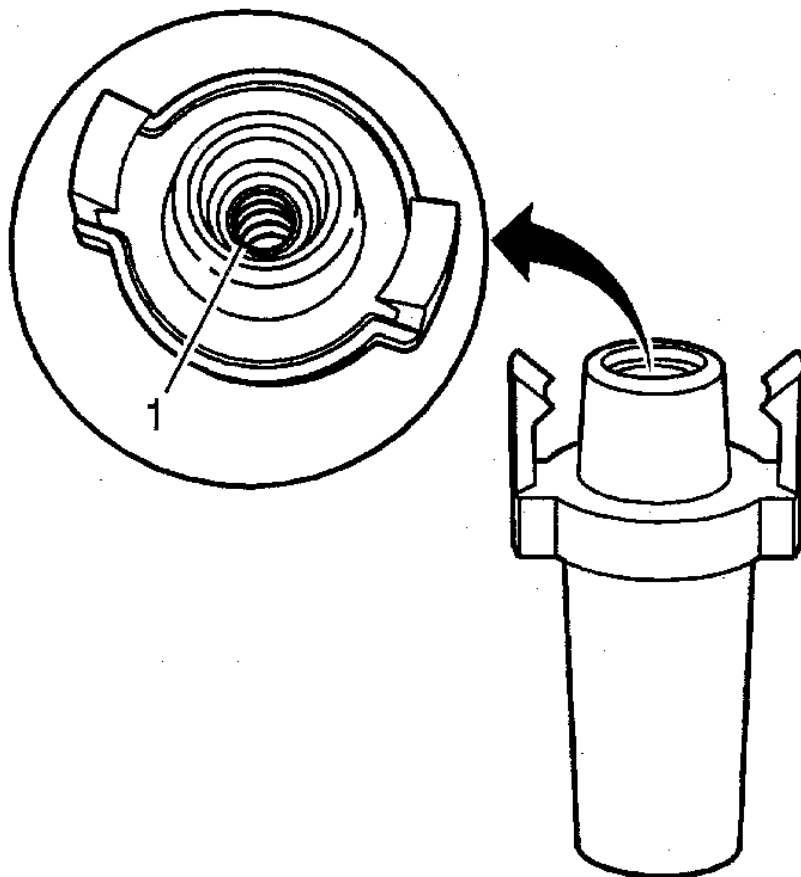

Portions of materials contained herein have been reprinted with permission of General Motors Corporation, Service Operations. This information is provided from the best available sources. However, AERA does not assume responsibility for data accuracy or consequences of its application. Members and others are not authorized to reproduce or distribute this material in any form, or issue it to their branches, divisions, or subsidiaries, etc. at a different location, without written permission.

© Copyright AERA 2006



Reference: